

3-4、FA8 Series Frequency / Industrial Frequency Meter FA8系列频率、工频测量仪表

Features:

- Seperate measurment for pulse signal/ industrial frequency parameter, etc.
- Industrial frequency with isolation, stable performance.
- Input pulse signal for making use of linespeed,tacho and frequency display functions exchangeable.

特点:

- 脉冲信号、工频等参数独立测量
- 工频输入带隔离，性能可靠
- 脉冲信号输入可实现线速、转速、频率三种显示功能切换使用

Code illustration 型号说明

FA8-RB10H ————— Blank空白 : Frequency/Tacho Meter 频率、线速、转速表
High voltage input industrial frequency meter H: 高压输入工频测量仪表
Reserved 预留
One input signal 1: 一路输入信号
Display only A: 单显示功能 B: With one alarm output 带一路报警输出
Blank 空白 : No output function 无输出功能 R: Relay output 继电器输出
Dimension 外形尺寸 (mm): 48H*96W*100L
FA Series Frequency / Industrial Frequency Meter FA系列频率、工频测量仪表




Ordering code 型号种类

Code型 号	Alarm 报警功能	Input signal 输入信号	Frequency upper line 频率测量上限	Display function 功能显示	辅助电压 Assistant voltage supply	Model 编 码
FA8-A10	NO	pulse code 5-30V脉冲型号	0-5000HZ	Optical Frequency/linespeed/ tacho display 频率、线速、转速可选显示	12V	0200FA0230
FA8-RB10	One alarm一路报警					0230FA0280
FA8-A10H	NO	Voltage range 60-380V电压范围	0-400HZ	Industrial frequency display 工频显示	None无	0230FA0280
FA8-RB10H	One alarm一路报警					0260FA0330

Technical specification 技术参数

Voltage supply 供电电压	AC 220V ± 10% 50HZ	Assistant voltage supply 辅助电压	12V 负载电流 load current ≤30mA
Power consumption 功 耗	≤3.5W	Working environment 使用环境	0-50℃ ≤85%R.H
Response speed 响应速度	About 1S 约1秒	Dielectric strength 耐 压	AC 2000V 1 minute
Measuring erro 测量误差	±0.1HZ	Insulated impedance 绝缘电阻	DC 500V ≥100M Ω
Display range 显示范围	0-9999		
Input voltage 输入电压	Industrial frequency meter 工频表 : 60-380V/AC, Frequency meter 频率表 : 5-30V Pulse voltage 脉冲电压		

Connecting drawing 接线图

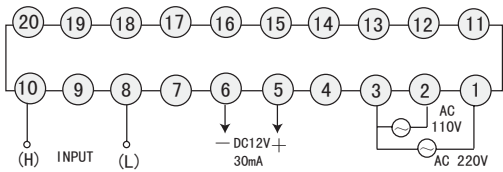

Dimension 外形尺寸

