Standard Test Method for Grain Crack and Extension of Leather by the Mullen Test¹

This standard is issued under the fixed designation D 2210; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers the determination of the resistance of leather to grain cracking and for measuring the extension of the leather. It is limited to light leathers such as shoe uppers, garment, gloves, and upholstery. This test method does not apply to wet blue.

1.2 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

2. Referenced Documents

2.1 ASTM Standards:

D 1610 Practice for Conditioning Leather and Leather Products for Testing²

D 1813 Test Method for Measuring Thickness of Leather Test Specimens²

3. Terminology

3.1 Definitions:

3.1.1 *extension*—the amount of stretch of leather over the diaphragm under pressure.

3.1.2 grain cracking—the appearance of cracks on the surface of the leather as the leather is extended over a diaphragm under pressure to form a sphere.

4. Significance and Use

4.1 The test method is designed to measure the force required to crack the grain of leather by steady hydraulic pressure on a diaphragm of definite diameter applied to the flesh side of the specimen to form a sphere. The cracking of the grain is a result of failure under elongation or stretch. The elongation or stretch of the leather can be measured at different loads or at the failure of the grain to determine if the stress leather will withstand under lasting conditions. Cuts, scratches, and other defects will cause considerable variation in the results by concentration of the applied force to the weak points.

 $^{\rm l}$ This test method is under the jurisdiction of ASTM Committee D31 on Leather and is the direct responsibility of Subcommittee D31.03 on Footwear. This test method was developed in cooperation with the American Leather Chemists Assn. (Standard Method E 58 – 1965).

Current edition approved Sept. 10, 2000. Published October 2000. Originally published as D 2210 – 63T. Last previous edition D 2210 – 93 (1997).

This test method is excellent for manufacturing control, specification acceptance, and service evaluation in the lasting property of leather. This test method may not apply when the conditions of the test employed differ widely from those specified in the test method.

5. Apparatus

5.1 Testing Machine,³ as shown in Fig. 1. The machine shall be hand- or power-driven. The machine shall hold the specimen firmly, without slippage, between two annular, plane, unpolished (matte) surfaces that may have fine, spiral tool marks not over 0.010 in. (0.25 mm) in depth.

5.2~Upper~Clamping~Surface—The upper clamping surface (clamping ring) shall have a circular opening 1.240 ± 0.010 in. (31.50 \pm 0.25 mm) in diameter and shall be connected to the clamping mechanism through a swivel joint to ensure an even clamping pressure.

5.3 Lower Clamping Surface—The lower clamping surface (diaphragm plate) shall be 0.219 ± 0.003 in. $(5.56 \pm 0.08$ mm) thick and have an opening of 1.240 ± 0.01 in. $(31.50 \pm 0.52$ mm) in diameter. The circular edges of the openings that come in contact with the specimen and the rubber diaphragm shall be rounded to a radius of not over 0.025 in. (0.64 mm) to prevent any cutting action. During the test, the circular edges of the openings in the two clamping plates shall be substantially concentric with no overlapping of any point.

5.4~Diaphragm, of rubber, 0.034 ± 0.002 in. $(0.86\pm0.05$ mm) thick, clamped under the lower clamping plate so that, before the diaphragm is stretched by pressure underneath it, the center of its upper surface is below the plane of the clamping surface.

5.5 *Dial Gage*, as shown in Fig. 2, to measure the extension of the leather specimen and mounted on the machine through screw shaft or on side of clamps on platform. This gage shall be calibrated to read directly to the nearest 0.001 in. (0.03 mm). It shall be equipped with a flat anvil and a presser foot.

5.6 Bourdon Tube—The apparatus shall be equipped with a Bourdon tube, maximum-reading-type, pressure gage graduated in pounds-force per square inch and accurate throughout the entire range of its scale to within a value of 1 % of its

² Annual Book of ASTM Standards, Vol 15.04.

³ The sole source of supply of the apparatus known to the committee at this time is B. F. Perkins, 939 Chicopee St., Chicopee, MA 01013-2797, (413) 536-1311. If you are aware of alternative suppliers, please provide this information to ASTM Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend.



FIG. 1 Mullen Tester, Model A

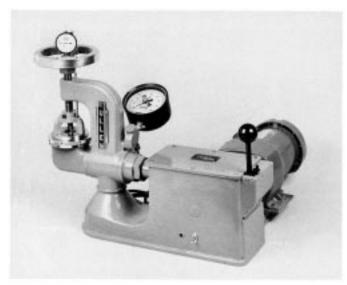


FIG. 2 Mullen Tester with Dial Gage

maximum capacity. The capacity of the gage shall be such that the individual readings will be not less than 25 % nor more than 75 % of the total capacity of the gage.

5.7 Pressure Control—The machine shall be equipped with means of applying controlled increasing hydraulic pressure to the underside of the diaphragm until the specimen cracks. This pressure shall be generated by a piston forcing a liquor (usually glycerin) into the pressure chamber of the apparatus. For machines shown in Fig. 1 where the cracking pressure is the only measurement, the pressure will be generated by pumping liquid at a rate of 170 ± 10 mL/min or by turning a handwheel at approximately $30 \, \text{r/min}$. For machines shown in Fig. 2 where cracking pressure and extension are measured, the pressure will be generated by pumping liquid at a rate of $15 \pm 2 \, \text{mL/min}$ or by turning a handwheel at approximately 3 r/min.

5.8 *Thickness Gage*—A dead-weight type of thickness gage as described in Test Method D 1813.

6. Test Specimen

- 6.1 The specimen shall be a square of leather 3 by 3 in. (76 by 76 mm) cut from the test unit of leather.
- 6.2 The specimen shall be free of mechanical damage and surface defects.

7. Conditioning

7.1 All specimens shall be conditioned for 48 h in an atmosphere maintained at 73.4 \pm 1.8°F (23 \pm 1°C) and 50 \pm 4% relative humidity and tested under these conditions as described in Practice D 1610.

8. Procedure

- 8.1 Determine the thickness of the specimen by taking three measurements in the area to be cracked and determine the average value.
- 8.2 Place the flesh side of the specimen in contact with the rubber diaphragm of the testing machine.
- 8.3 Clamp the specimen securely in the apparatus in such a manner that the leather will not be damaged.
- 8.4 Rest the presser foot of the extension gage on the flat surface of the specimen and set the gage at zero.
- 8.5 Apply pressure to the specimen until the specimen cracks.
- 8.6 At the moment the first crack appears in the specimen stop the machine, note the applied pressure from the gage, and record the value as the cracking strength of the specimen.

9. Report

- 9.1 The report shall include the following:
- 9.1.1 Cracking pressure to the nearest 5 psi (35 kPa) for each specimen or averaged and reported as the average of the test unit.
- 9.1.2 Extension of the leather to the nearest 0.001 in. (0.03 mm), converted to percentage (see Annex A1) and reported as percentage stretch, and
 - 9.1.3 Thickness to the nearest 0.001 in. (0.03 mm) reported



for each specimen or averaged and reported as the thickness of the sample.

9.1.4 Speed the liquid was pumped to build pressure to the nearest 10 % (see 5.7).

10. Precision and Bias

- 10.1 The following criteria may be used to judge the acceptability of the results if at least 15 units have been tested:
- 10.1.1 *One Operator, Duplicate Specimens, Same Skin*—Results by the same operator in duplicate adjacent specimens in a skin taken from the official sampling position should not be considered suspect unless the coefficient of variation exceeds:

Leathers	Cracking Pressure, psi	Extension at Grain Crack, %		
Shoe upper	26	13		
Upholstery	17	14		
Calfskin ^A	16	22		
Glove	11	20		

 $^{^{}A}$ 3 \pm 1 oz, 0.0468 \pm 0.0156 in. (1.189 \pm 0.396 mm).

10.1.2 Two Laboratories, Duplicate Specimens, Same Skin—Results for the same group of light leathers listed in 10.1.1 submitted by each of two laboratories on duplicate adjacent specimens in a skin taken from the official sampling position should not be considered suspect unless the two average results differ by more than 5 %.

Note 1—The reproducibility reported in 10.1.2 is based on data obtained at two laboratories, and a different operator. The results show close correlation between laboratories.

Note 2—The results given in Section 10 are based on tests on 30 sides of leather and do not apply to findings and cut parts.

Note 3—The precision data for between skins are not included because the results were based on different skins from several production lots. The variables in leather for between skins will give a higher variation of the results, but this factor should not affect the precision of the method.

11. Keywords

11.1 burst strength extension; grain crack; leather; Mullen

ANNEX

(Mandatory Information)

A1. DERIVATION OF EQUATION FOR PERCENTAGE STRETCH

A1.1 Referring to Fig. A1.1,

h =deflection (measured by Mullen tester), and

 $a = \text{radius of test area } (0.625 \text{ in.} = \frac{5}{8} \text{ in.})$

From geometry, $z = 2\pi rh$, $u = \pi a^{-2}$, and h + i = r. but:

$$i = \sqrt{r^2 - a^2} \tag{A1.1}$$

then:

$$h + \sqrt{r^2 - a^2} = r \tag{A1.2}$$

solving for r:

$$r = (a^2 + h^2)/2h (A1.3)$$

Stretch, % = 100 [(z - u)/u] = 100 [$(2\pi rh - \pi a^2)/\pi a^2$] = 100 $\left(\frac{2h[(a^2 + h^2)/2h] - a^2}{a^2}\right)$ = 100 (h^2/a^2) = 100 $h^2/(25/64)$ = 100

 $= 100 (2.56 h^2)$

FIG. A1.1 Geometry for Derivation of Equation for Percentage Stretch



TABLE A1.1 Conversion Table From h to Percentage Stretch (2.56 $h^2 \times 100$) (for Values of h Between 0.2 and 0.5 in.)

h, in.	Stretch, %	<i>h</i> , in.	Stretch,%	<i>h</i> , in.	Stretch, %	<i>h</i> , in.	Stretch, %
200 × 10 ⁻³	10.24	276 × 10 ⁻³	19.50	352 × 10 ⁻³	31.72	428 × 10 ⁻³	46.90
201	10.34	277	19.64	353	31.90	429	47.11
02	10.45	278	19.78	354	32.08	430	47.33
03	10.55	279	19.93	355	32.26	431	47.55
04	10.65	280	20.07	356	32.44	432	47.78
05	10.76	281	20.21	357	32.63	433	48.00
06	10.86	282	20.36	358	32.81	434	48.22
07	10.97	283	20.50	359	32.99	435	48.44
08	11.08	284	20.65	360	33.18	436	48.66
09	11.18	285	20.70	361	33.36	437	48.89
10	11.29	286	20.94	362	33.55	438	49.11
11	11.40	287	21.09	363	33.73	439	49.34
12	11.51	288	21.23	364	33.92	440	49.56
13	11.61	289	21.38	365	34.11	441	49.79
14	11.72	290	21.53	366	34.29	442	50.01
15	11.83	291	21.68	367	34.48	443	50.24
16	11.94	292	21.83	368	34.67	444	50.47
17	12.08	293	21.98	369	34.86	445	50.69
18	12.17	294	22.13	370	35.05	446	50.92
19	12.28	295	22.28	371	35.24	447	51.15
20	12.39	296	22.43	372	35.43	448	51.38
21	12.50	297	22.58	373	35.62	449	51.61
22	12.62	298	22.73	374	35.81	450	51.84
23	12.73	299	22.89	375	36.00	451	52.07
24	12.85	300	23.04	376	36.19	452	52.30
25	12.96	301	23.19	377	36.39	453	52.53
26	13.08	302	23.35	378	36.58	454	52.77
27	13.19	303	23.50	379	36.77	455	53.00
28	13.31	304	23.66	380	36.97	456	53.23
29	13.42	305	23.81	381	37.16	457	53.47
30	13.54	306	23.97	382	37.36	458	53.70
31	13.66	307	24.13	383	37.55	459	53.93
32	13.78	308	24.29	384	37.75	460	54.17
33	13.90	309	24.44	385	37.95	461	54.41
34	14.02	310	24.60	386	38.14	462	54.64
35	14.14	311	24.76	387	38.34	463	54.88
36	14.26	312	24.92	388	38.54	464	55.12
37	14.38	313	25.08	389	38.74	465	55.35
38	14.50	314	25.24	390	38.94	466	55.59
39	14.62	315	25.40	391	39.14	467	55.83
40	14.75	316	25.56	392	39.34	468	56.07
41	14.87	317	25.73	393	39.54	469	56.31
42	14.99	318	25.89	394	39.74	470	56.55
43	15.12	319	26.05	395	39.94	471	56.79
44	15.24	320	26.21	396	40.14	472	57.03
45	15.37	321	26.38	397	40.35	473	57.27
46	15.49	322	26.54	398	40.55	474	57.52
47	15.62	323	26.71	399	40.76	475	57.76
		324		400	40.76	476	58.00
48	15.75		26.87				
49	15.87	325	27.04	401	41.17	477	58.25
50	16.00	326	27.21	402	41.37	478	58.49
51	16.13	327	27.37	403	41.58	479	58.73
52	16.26	328	27.54	404	41.78	480	58.98
53	16.39	329	27.71	405	41.99	481	59.23
54	16.52	330	27.88	406	42.20	482	59.47
55	16.65	331	28.05	407	42.41	483	59.72
56	16.78	332	28.22	408	42.61	484	59.97
57	16.91	333	28.39	409	42.82	485	60.22
58	17.04	334	28.56	410	43.03	486	60.47
59	17.17	335	28.73	411	43.24	487	60.72
60	17.31	336	28.90	412	43.45	488	60.96
61	17.44	337	29.07	413	43.67	489	61.21
62	17.57	338	29.35	414	43.88	490	61.47
63	17.71	339	29.42	415	44.09	491	61.72
54	17.84	340	29.59	416	44.30	492	61.97
65	17.98	341	29.77	417	44.52	493	62.22
66	18.11	342	29.94	418	44.73	494	62.47
67	18.25	343	30.12	419	44.94	495	62.73
68	18.39	344	30.29	420	45.16	496	62.98
59 	18.52	345	30.47	421	45.37	497	63.23
70	18.66	346	30.65	422	45.59	498	63.49
71	18.80	347	30.82	423	45.81	499	63.74
72	18.94	348	31.00	424	46.02	500	64.00
73	19.08	349	31.18	425	46.24		
74	19.22	350	31.36	426	46.46	•••	
75	19.36	351	31.54	427	46.68		

TABLE A1.2 Conversion Table From h to Percentage Stretch (2.56 h $^2 \times$ 100) (for Values of h Between 5.08 and 12.70 mm)

			i to Percentage Str	`	, ,		,
<i>h</i> , mm	Stretch, %	h, mm	Stretch,%	<i>h</i> , mm	Stretch, %	<i>h</i> , mm	Stretch, %
5.08	10.24	6.99	19.36	8.89	31.36	10.80	46.24
5.11	10.34	7.01	19.50	8.92	31.54	10.82	46.46
5.13	10.45	7.04	19.64	8.94	31.72	10.85	46.68
5.16	10.55	7.06	19.78	8.97	31.90	10.87	46.90
5.18	10.65	7.09	19.93	8.99	32.08	10.90	47.11
5.21	10.76	7.11	20.07	9.02	32.26	10.92	47.33
5.23	10.86	7.14	20.21	9.04	32.44	10.95	47.55
5.26	10.97	7.16	20.36	9.07	32.63	10.97	47.78
5.28	11.08	7.19	20.50	9.09	32.81	11.00	48.00
5.31	11.18	7.21	20.65	9.12	32.99	11.02	48.22
5.33	11.29	7.24	20.70	9.14	33.18	11.05	48.44
5.36	11.40	7.26	20.94	9.17	33.36	11.07	48.66
5.38	11.51	7.29	21.09	9.19	33.55	11.10	48.89
5.41	11.61	7.32	21.23	9.22	33.73	11.13	49.11
5.44	11.72	7.34	21.38	9.25	33.92	11.15	49.34
5.46	11.83	7.37	21.53	9.27	34.11	11.18	49.56
5.49	11.94	7.39	21.68	9.30	34.29	11.20	49.79
5.51	12.08	7.42	21.83	9.32	34.48	11.23	50.01
5.54	12.17	7.44	21.98	9.35	34.67	11.25	50.24
5.56	12.28	7.47	22.13	9.37	34.86	11.28	50.47
5.59	12.39	7.49	22.28	9.40	35.05	11.30	50.69
5.61	12.50	7.52	22.43	9.42	35.24	11.33	50.92
5.64	12.62	7.54	22.58	9.45	35.43	11.35	51.15
5.66	12.73	7.57	22.73	9.47	35.62	11.38	51.38
5.69	12.85	7.59	22.89	9.50	35.81	11.40	51.61
5.72	12.96	7.62	23.04	9.53	36.00	11.43	51.84
5.74	13.08	7.65	23.19	9.55	36.19	11.46	52.07
5.77	13.19	7.67	23.35	9.58	36.39	11.48	52.30
5.79	13.31	7.70	23.50	9.60	36.58	11.51	52.53
5.82	13.42	7.72	23.66	9.63	36.77	11.53	52.77
5.84	13.54	7.75	23.81	9.65	36.97	11.56	53.00
5.87	13.66	7.77	23.97	9.68	37.16	11.58	53.23
5.89	13.78	7.80	24.13	9.70	37.36	11.61	53.47
5.00			24.29				
5.92	13.90	7.82		9.73	37.55	11.63	53.70
5.94	14.02	7.85	24.44	9.75	37.75	11.66	53.93
5.97	14.14	7.87	24.60	9.78	37.95	11.68	54.17
5.99	14.26	7.90	24.76	9.80	38.14	11.71	54.41
6.02	14.38	7.92	24.92	9.83	38.34	11.73	54.64
6.05	14.50	7.95	25.08	9.86	38.54	11.76	54.88
	14.62	7.98	25.24				
6.07				9.88	38.74	11.79	55.12
6.10	14.75	8.00	25.40	9.91	38.94	11.81	55.35
6.12	14.87	8.03	25.56	9.93	39.14	11.84	55.59
6.15	14.99	8.05	25.73	9.96	39.34	11.86	55.83
6.17	15.12	8.08	25.89	9.98	39.54	11.89	56.07
6.20	15.24	8.10	26.05	10.01	39.74	11.91	56.31
						11.51	
6.22	15.37	8.13	26.21	10.03	39.94	11.94	56.55
6.25	15.49	8.15	26.38	10.06	40.14	11.96	56.79
6.27	15.62	8.18	26.54	10.08	40.35	11.99	57.03
6.30	15.75	8.20	26.71	10.11	40.55	12.01	57.27
6.32	15.87	8.23	26.87	10.13	40.76	12.04	57.52
6.35	16.00	8.26	27.04	10.16	40.96	12.07	57.76
6.38	16.13	8.28	27.21	10.19	41.17	12.09	58.00
6.40	16.26	8.31	27.37	10.21	41.37	12.12	58.25
6.43	16.39	8.33	27.54	10.24	41.58	12.14	58.49
6.45	16.52	8.36	27.71	10.26	41.78	12.17	58.73
6.48	16.65	8.38	27.88	10.29	41.99	12.19	58.98
6.50	16.78	8.41	28.05	10.31	42.20	12.22	59.23
6.53	16.91	8.43	28.22	10.34	42.41	12.24	59.47
6.55	17.04	8.46	28.39	10.36	42.61	12.27	59.72
	17.17	8.48	28.56	10.39	42.82	12.29	59.97
6.58			28.73	10.41	43.03	12.32	60.22
		8.51	20.70				00.22
6.60	17.31						
6.60 6.63	17.31 17.44	8.53	28.90	10.44	43.24	12.34	60.47
6.60 6.63 6.65	17.31 17.44 17.57	8.53 8.56	28.90 29.07	10.44 10.46	43.24 43.45	12.34 12.37	60.47 60.72
6.60 6.63 6.65 6.68	17.31 17.44 17.57 17.71	8.53 8.56 8.59	28.90 29.07 29.35	10.44 10.46 10.49	43.24 43.45 43.67	12.34 12.37 12.40	60.47 60.72 60.96
6.60 6.63 6.65 6.68 6.71	17.31 17.44 17.57 17.71 17.84	8.53 8.56 8.59 8.61	28.90 29.07 29.35 29.42	10.44 10.46 10.49 10.52	43.24 43.45 43.67 43.88	12.34 12.37 12.40 12.42	60.47 60.72 60.96 61.21
6.60 6.63 6.65 6.68 6.71	17.31 17.44 17.57 17.71	8.53 8.56 8.59	28.90 29.07 29.35	10.44 10.46 10.49	43.24 43.45 43.67	12.34 12.37 12.40	60.47 60.72 60.96
6.60 6.63 6.65 6.68 6.71 6.73	17.31 17.44 17.57 17.71 17.84 17.98	8.53 8.56 8.59 8.61 8.64	28.90 29.07 29.35 29.42 29.59	10.44 10.46 10.49 10.52 10.54	43.24 43.45 43.67 43.88 44.09	12.34 12.37 12.40 12.42 12.45	60.47 60.72 60.96 61.21 61.47
6.60 6.63 6.65 6.68 6.71 6.73 6.76	17.31 17.44 17.57 17.71 17.84 17.98 18.11	8.53 8.56 8.59 8.61 8.64 8.66	28.90 29.07 29.35 29.42 29.59 29.77	10.44 10.46 10.49 10.52 10.54 10.57	43.24 43.45 43.67 43.88 44.09 44.30	12.34 12.37 12.40 12.42 12.45 12.47	60.47 60.72 60.96 61.21 61.47 61.72
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25	8.53 8.56 8.59 8.61 8.64 8.66 8.69	28.90 29.07 29.35 29.42 29.59 29.77 29.94	10.44 10.46 10.49 10.52 10.54 10.57 10.59	43.24 43.45 43.67 43.88 44.09 44.30 44.52	12.34 12.37 12.40 12.42 12.45 12.47 12.50	60.47 60.72 60.96 61.21 61.47 61.72 61.97
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39 18.52	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71 8.74	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12 30.29	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62 10.64	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22 62.47
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83 6.86	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39 18.52 18.66	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71 8.74	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12 30.29 30.47	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62 10.64 10.67	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73 44.94	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52 12.55 12.57	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22 62.47 62.73
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83 6.86 6.88	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39 18.52 18.66 18.80	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71 8.74 8.76	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12 30.29 30.47 30.65	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62 10.64 10.67 10.69	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73 44.94 45.16 45.37	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52 12.55 12.57	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22 62.47 62.73 62.98
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83 6.86 6.88 6.91	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39 18.52 18.66 18.80 18.94	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71 8.74 8.76 8.79 8.81	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12 30.29 30.47 30.65 30.82	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62 10.64 10.67 10.69 10.72	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73 44.94 45.16 45.37 45.59	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52 12.55 12.57 12.60 12.62	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22 62.47 62.73 62.98 63.23
6.60 6.63 6.65 6.68 6.71 6.73 6.76 6.78 6.81 6.83	17.31 17.44 17.57 17.71 17.84 17.98 18.11 18.25 18.39 18.52 18.66 18.80	8.53 8.56 8.59 8.61 8.64 8.66 8.69 8.71 8.74 8.76	28.90 29.07 29.35 29.42 29.59 29.77 29.94 30.12 30.29 30.47 30.65	10.44 10.46 10.49 10.52 10.54 10.57 10.59 10.62 10.64 10.67 10.69	43.24 43.45 43.67 43.88 44.09 44.30 44.52 44.73 44.94 45.16 45.37	12.34 12.37 12.40 12.42 12.45 12.47 12.50 12.52 12.55 12.57	60.47 60.72 60.96 61.21 61.47 61.72 61.97 62.22 62.47 62.73 62.98



The American Society for Testing and Materials takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).